



Art.-Nr: KEU029ML Safety luminaire Central power supply Universal, ML, Central power supply, , IP40, Plastic, white

Compact polycarbonate luminaire with ERT-LED for universal mounting and for the lighting of escape and rescue routes according to DIN EN 605981, DIN EN 60598-2-22 and EN 1838. Available for central power systems or as a self-contained luminaire. Also available as ERT luminaire with improved illumination. Plastic, white, IP40 Universal mounting (incl.: wall (W), ceiling (D), wall bracket)





More information




TECHNICAL DATA

Luminaire type	Safety luminaire
Mounting	Universal
Pictograph	No
Illuminant	LED
Housing material	Plastic
Housing color	white
Protection type (IP)	IP40
Impact resistance (IK)	≥ 3
Certification	Waste disposal, CE, TÜV Rheinland Type approved, ENEC
Insulation class	2
Supply	Central power supply
Monitoring	ML
Bridging time	Central power supply
Operating mode	single luminaire switching
Input voltageAC	230 V
Input frequency	50 / 60 Hz
Input voltage DC	216 V
Power max.	5,2 W
Power DS	5,2 W
Power BS	1,1 W
Depth	332 mm
Width	48 mm





Height	72 mm				
Weight	0.39				
Weight incl. packaging	0.43				
Connection cross-section	2.5 mm ²				
Switching input	Yes				
Emergency light blocking	No				
Battery connection	No				
Dimming function	Yes				
Luminous flux mains	520 lm				
Luminous flux emergency	520 lm				
Customs tariff number	94056120				
Country of origin	DEUTSCHLAND				
EAN	4260123682620				

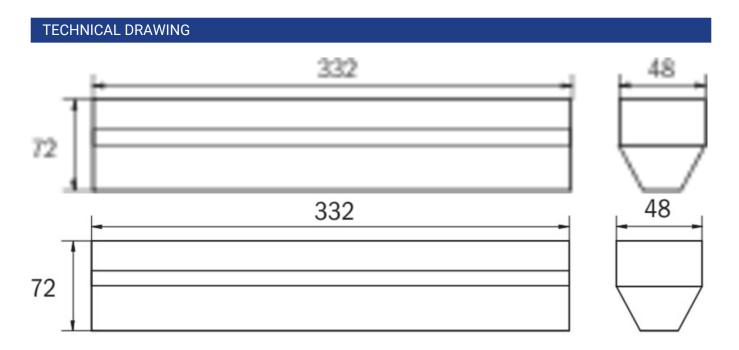





ACCESSORY LIST

DSA -

KEE-EB -

2PW-EB -

2DW-EB-

KXBE -

RELATED PRODUCTS

ArtNo. Image Monitoring Supply Color Investment Automatic log Maintenance level Remote maintenance max. luminaires Single luminaire monitoring	ArtNo.	o. Image	Monitoring	Supply	Color	Investment	Automatic log	Maintenance level	Remote maintenance	max. luminaires	Single luminaire monitoring
--	--------	----------	------------	--------	-------	------------	---------------	-------------------	--------------------	-----------------	-----------------------------

As of: 29.06.2024 - Subject to technical changes and errors.